



Vehicle Inspection Report

Date	5/22/2018	
Buyer	George	
Phone	0402 444 888	
Seller	John	
Phone	0432 799 444	
Make	Ford	
Model	Territory	
Badge/ Series	GS	
Colour	Grey	
Comply/Build Date	Feb-09	Feb-09
Registration No	ABS 47P	
Registration Expiry	10/19/2018	
Kilometer Reading	175,517	
Vin/ Serial Number	6FPAAAJGER9U45674	
Engine Number		

Code:
P/S Passenger Side

D/S Driver's Side

D/S/F Driver's Side Front

D/S/R Driver's Side Rear

D/S/R Driver's Side Rear

P/S/R Passenger Side Rear

Minor Repairs
Recommended Repairs
Immediate Repairs

		ENGINE	OK	NO	Comments			
1		Engine Idle	*					
1a		Engine Oil Condition	*		Good	Fair	Dirty	Very Dirty
2		Engine oil leaks		□				
3		Fumes/Smoke	*					
4		Engine Main Seals		□				Rear main seal (slight leak)
5		Rocker Cover Gasket	*					
6		Engine Sump Gasket		□				Slight leak
7		Fluid Levels	*					
8		Engine Mounts	*					Replaced
9		Emission controls	*					
10		Drive belts & pulleys	*					
11		Fan (Electric)	*					
12		Hoses/Pipes	*					
13		Fuel system (injectors)	*					
14	NA	Camshaft timing belt (see below)						
15	NA	Turbo/Intercooler						
16		Inlet Manifold leaks	*					
17		Engine noises	*					
18	NA	Compression Test						

Usually, timing belts can't be physically checked. You must refer to the manufacturer's specifications in order to confirm replacement times.

Additional Comments

P/S/F engine block (minor leak) under thermostat housing		

TRANSMISSION/ GEARBOX			OK	NO	Comments
19		Operation	*		
20	NA	Clutch (Man)			
21		Inhibitor Switch (Auto)	*		
22	NA	Gear Linkages (Man)			
23		Gear Shifting (Auto)	*		
24		Mountings	*		
24a		Auto Fluid Condition	*		
25		Fluid/Oil leaks	*		
26		Noises	*		
27	NA	Transfer Case (4x4 or AWD)			

Additional Comments

ELECTRICAL SYSTEM			OK	NO	Comments
28		Charging System	*		Charging Voltage 13.66
29		Ignition system	*		
30		Ignition Barrel/ Key(s)	*		1 2 3
31		Battery	*		
32		Battery Load Test	*		
33		Battery Cables/Terminals	*		
34		Starter motor cranking	*		Starter Motor Previously replaced
35		Core Packs	*		
36		Headlights	*		
37		Tail lights	*		
38		Blinkers	*		
39		Brake Lights	*		
40		Parking lights	*		
41		Number Plate Lights	*		
42		Hazard Lights	*		
43		Horn	*		
44		Power Windows	*		
45		Central locking/remotes	*		None 1 2 3
46		Power mirrors	*		
47		Window wipers & washers	*		
48	NA	Sunroof			
49	NA	Fog/driving lights (front & rear)			
50		Alarm (immobiliser)	*		
51		Electric Seats (D/S Front)	*		

Additional Comments

AIR CONDITIONING			OK	NO	Comments
52		Operation	*		
53		Condenser	*		
54		Compressor	*		
55		Pipes/ Hoses	*		
56		Gas	*		
57		Belts	*		
58		Leaks	*		

Additional Comments

			OK	NO	Comments		
59		Radiator & cap	*				
60		Hoses & pipes	*				
61		Water pump & fan	*				
62		Radiator coolant level	*				
63		Inhibitor/coolant concentration		□	Weak	Average	Strong
64		Leaks	*				
65		Pressure Test	*				

Additional Comments

Coolant weak & needs to be replaced

EXHAUST SYSTEM			OK	NO	Comments
66		Catalytic Converter Function	*		
67		Mufflers x 2	*		
68		Exhaust Manifold	*		
69		Exhaust Pipes x2	*		
70		Tailpipe(s)	*		
71		Brackets/ Fittings	*		
72		Leaks	*		

Additional Comments

STEERING & SUSPENSION			OK	NO	Comments
73		Front suspension/shocks	*		
74		Rear suspension/shocks	*		
75		Wheel bearings	*		
76		Drive shafts, Boots, & Uni Joints	*		
77		Ball Joints/ Tie Rod Ends	*		
78		Rack & Pinion/ Steering Box		□	D/S/F rack boot (small split)
79		Sway Bar/Control Arm Bushes	*		

Additional Comments

P/S/F rack boot (minor leak)
P/S/F lower control arm (replaced)
Minor leak under P/S reservoir

4

BRAKES			OK	NO	Comments						
80		Master cylinder/ booster	*								
81		Brake Pedal	*								
82		Brake callipers	*								
83		Hoses & pipes	*								
84		Front brake pads		□			30%		% remaining		
85		Rear brake pads		□			30%		% remaining		
86		Front Brake Rotors	*								
87		Rear brake rotors	*								
88	NA	Rear Wheel cylinders									
89		Hand brake	*								
90		Brake Fluid Moisture Content	*				0 %	<1%	<2%	<3%	>4%

Additional Comments

TYRES & WHEELS			OK	NO	Comments					
91		Front Tyre Condition	*			D/S 70	P/S 70		% Remaining	
92		Rear Tyre Condition	*			D/S 60	P/S 60		% Remaining	
93		Spare Tyre (space saver)	*			90			% Remaining	
94		Alloy Wheel Condition		□		3 x scratches/marks		P/S/F (scraped)		
95	NA	Rims/Wheel caps								

Additional Comments

UNDERBODY			OK	NO	Comments					
96		Sub frame/ members	*							
97		Mounting points	*							
98		Under floor panels	*							
99		Fuel tank & hoses	*							
100		Differential		□		Rear cover plate (leak)				

Additional Comments

INTERIOR		OK	NO	Comments
101		*	☐	D/S/F seat (bottom material detached)
102		*		
103		*	☐	Dirt marks/spots
104		*		
105		*		
106		*		
107		*		
108		*		
109		*		
110		*		
111		*		
112		*		
113		*		
114		*		
115		*		
116		*		
117		*		
118		*		
119		*		
120		*		
121		*		
122		*		
123		*		
124		*		
125		*		
126		*		
127		*		
128		*		
129	NA	*		
130		*		
131	NA	*		
132		*		
133		*		
134		*		
135		*		
136		*		
137		*		
138		*		
139		*		

Additional Features				

	Engine Stop/Start System	Green	Yellow	Orange	Red
	Front Seats (electric & heated)	Green	Yellow	Orange	Red
	Headlights (Light Sensitive)	Green	Yellow	Orange	Red
	Hill Holder	Green	Yellow	Orange	Red
	Hill Descent	Green	Yellow	Orange	Red
	Keyless Start Button	Green	Yellow	Orange	Red
	Key FOB Proximity Related	Green	Yellow	Orange	Red
		Green	Yellow	Orange	Red
	Lane Departure Warning	Green	Yellow	Orange	Red
	Multi Function Screen	Green	Yellow	Orange	Red
	Parking Assistance Display	Green	Yellow	Orange	Red
	Park Distance Alert (Fr & R)	Green	Yellow	Orange	Red
	Power Boot Closing	Green	Yellow	Orange	Red
	Steering Wheel (Multi Function)	Green	Yellow	Orange	Red
	Voice Recognition	Green	Yellow	Orange	Red
	Wipers (rain sensitive)	Green	Yellow	Orange	Red
	Alert Warning - Collision Fwd	Green	Yellow	Orange	Red
	Corner Braking	Green	Yellow	Orange	Red
	Crash Avoidance with Braking	Green	Yellow	Orange	Red
	Distance Control	Green	Yellow	Orange	Red
	Door Mirrors (heated)	Green	Yellow	Orange	Red
	Gearshift Paddles (behind wheel)	Green	Yellow	Orange	Red
	Headlights (Active Cornering)	Green	Yellow	Orange	Red
	Head Up Info Display (HUD)	Green	Yellow	Orange	Red
	Ride Height (electronic)	Green	Yellow	Orange	Red
	Reverse Traffic Detection	Green	Yellow	Orange	Red
	Speed Limiter	Green	Yellow	Orange	Red

6

Additional Comments

EXTERIOR		OK	NO	Comments
140	Bonnet/ Boot Struts & Locks	*		
141	Door Handles & Locks	*		
142	Door Moulds	*		
143	Door mirrors	*		
144	Door pillars	*		
145	Windscreen (F & R)	*		
146	Windows & Trims	*		
147	Wiper rubbers (F & R)	*		
148	Chassis & Rails	*		
149	Inner guards	*		
150	Front grill	*		
151	Roof rack (rails)	*		
152	Head lights	*		
153	Tail lights	*		
154	Blinkers	*		
155	Number plates	*		
156	Tow bar (tongue & plug)	*		
157	Badges	*		
158	Mud flaps (front & rear)	*	□	D/S/R (loose)

Additional Comments

BODY CONDITION & PAINT THICKNESS			Ums	NO	Comments
159		D/S/F Guard	95		Previous respray
160		D/S/F Door	200		Previous respray
				☐	Ding on centre of door panel
161		D/S/R Door	190		Previous respray
				☐	Ding on front of door panel
162		D/S/R ¼ Panel	160		
163		Rear bumper bar			Light scratches & marks
164		Rear Boot/hatch	170		
165		P/S/R ¼ Panel	150		
166		P/S/R Door	180		Previous respray
167		P/S/F Door	200		Previous respray
					Small ding/marks on centre of panel
168		P/S/F Guard	250		Previous respray
169		Front bumper bar			
170		Front bonnet	180		Previous respray
171		F & R Spoilers			
172		Lower Side skirts			
173		Roof	150		






NOTE: Paint Thickness measured in micron units (Ums)

Additional Comments

P/S/F wiper arm (paint peeling)

BODY PANEL & PAINTWORK DAMAGE

—	Paint Scratch	•	Ding/s	☐	Overspray	☒	Clear-coat Failure
≡	Paint Scraped	○	Dent/s	XX	Paint Runs	≡	Rust
⋯	Paint Marked	∴	Hail	☒	Oxidation	~	Bent
*	Paint Blemish	Chip/s	☒	Blistering	L	Loose
☒	Paint Faded	0	Crease	*	Cracking		Gap
☒	Paint Re-sprayed	XXX	Paint Peeling	☒	Crazing		
xxx	Paint Scuffed	☒	Orange Peel	##	Paint Rough		

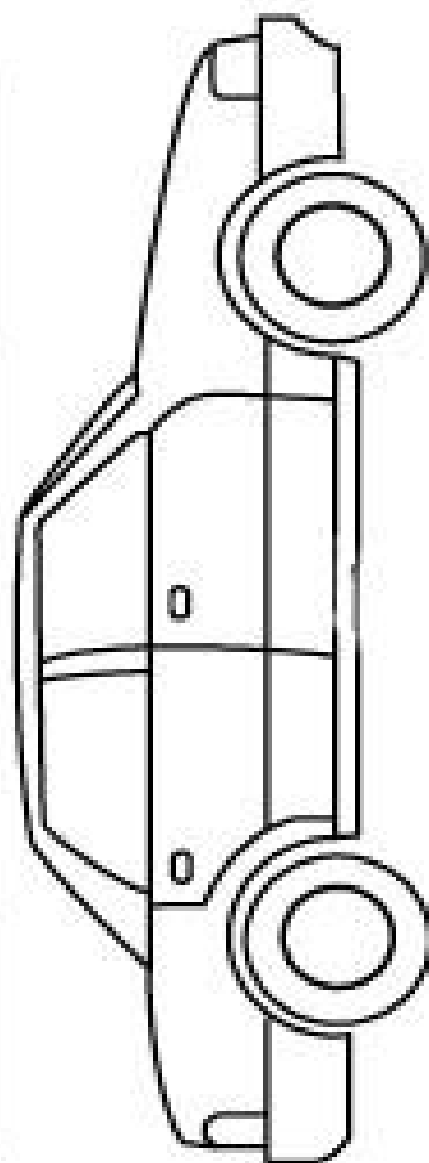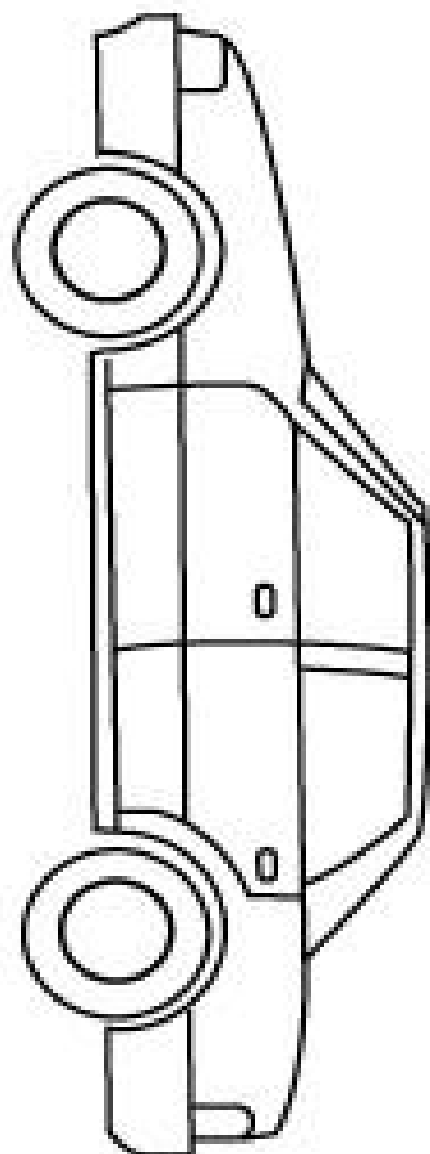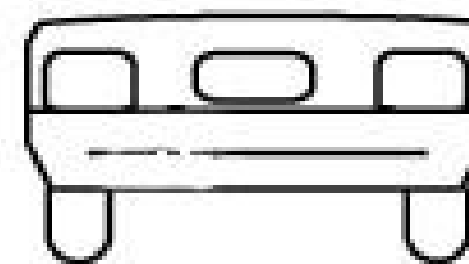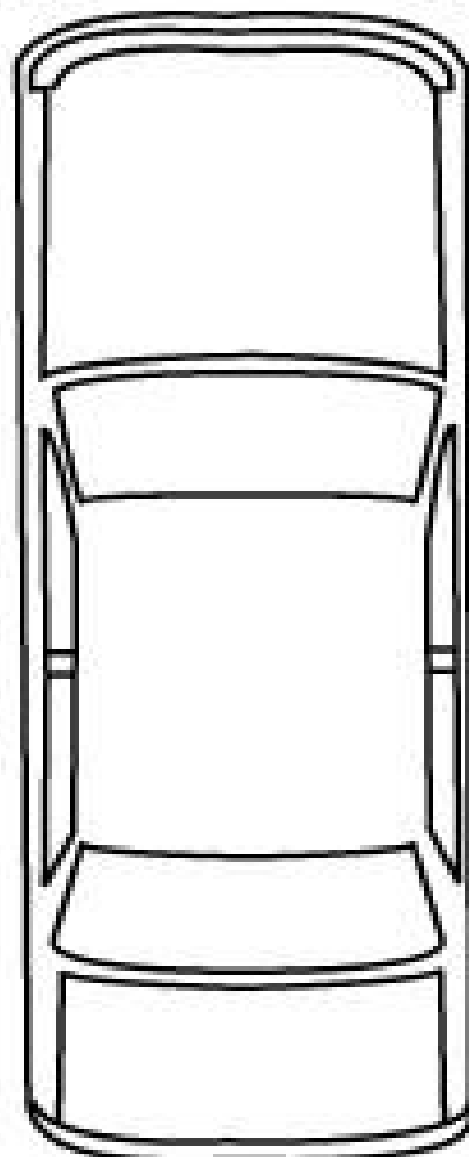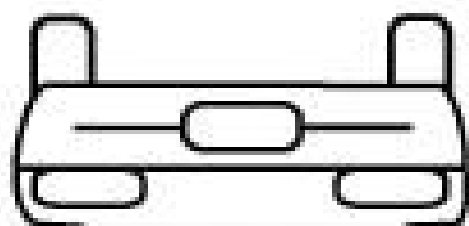

ROAD TEST			OK	NO	Comments		
174		Engine performance	*				
175		Exhaust smoke	*				
176		Transmission/ gearbox	*				
177		Differential/ drive train	*				
178		Steering/ suspension	*				
179		Braking/ pedal operation	*				
180		Speedo operation	*				
181		Cruise control	*				
182		Car Performance	Poor	Fair	Good	V.Good	Excellent
183		Engine	Misfire	Rough	Uneven	Even	Smooth
184		Acceleration	Poor	Fair	Good	V.Good	Excellent
185		Handling	Poor	Fair	Good	V.Good	Excellent
186		Ride	Soft	Hard	Normal	Smooth	V.Smooth
187		Overall condition for age/kms	Poor	Fair	Good	V.Good	Excellent

Note: Criteria is ranked for the vehicle make, model, age, and kms.

Additional Comments

LOG BOOKS & SERVICING

Log Books supplied	Yes	No	Stamped	Yes	No	Partial
Additional receipts supplied	Yes	No				
Car regularly serviced	Yes	No	Intermitent			
Last Log Book Service at	Date	15/08/2016	at	113,766		Kms
Next service due at	Date	4/19/2018	at	180,000		Kms

Additional Comments

Recent oil changes done by owner & not listed in log book

REPAIRS NEEDED (as listed above)

Immediate Repairs (or within 3 mths)	
1	Differential rear cover plate (leaking) - replace gasket & re-seal

Recommended Repairs (within 6-12 months or at next service interval)	
2	Engine Sump Gasket (small leak) - replace gasket
3	Front brake pads (30% remaining) - replace
4	Rear brake pads (30% remaining) - replace
5	D/S/F rack boot (split on end) - replace
6	Radiator coolant weak - replace

Minor Repairs (after 12 months but monitor at each service)	
7	Rear main seal (slight leak) - degrease/ check/ replace if necessary
8	P/S/F engine block (minor leak) under thermostat housing- degrease/ check for leak/ replace
9	Minor leak under Power Steering reservoir - degrease/ check for source of leak/ replace
10	Buff marks & scratches
11	Detail interior
12	Remove dings on D/S/F & D/S/R door panels
13	Re-paint wiper arms

Note:

All of our inspections are based on a physical description of what is seen and heard by us. We do not advise on the precise value of the vehicle or authenticate its origin. We are not responsible for any problems that can occur after an inspection is completed. However, Sydney Auto Inspections guarantees each inspection to be accurate at the time the vehicle is inspected. Physical and mechanical damage can occur between the time a vehicle is inspected and when the vehicle is actually purchased. Therefore, we cannot be held responsible for those occurrences should they ever happen. Any guaranties or warranties implied or not on any vehicle inspected by Sydney Auto Inspections is strictly with the seller of that vehicle.

If you need to discuss any item in this report, then please contact:

Peter 0402 408 936



Sydney Auto Inspections

86 High St

Carlton, NSW, 2218

Ph. (02) 9593 1769

Email. pjenkyns@optusnet.com.au

